

Work Order ID 136082

August 28, 2015 11:30:20 AM

136082

Page 1

Item ID: D212-664-201 Accept *N900040100* Setup Start *NS1*
 Revision ID: Stop *NS2*
 Item Name: Aft Crosstube - High
 Start Date: 8/28/2015 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 9/11/2015 Req'd Qty: 1.00 *1* Customer:
 Reference:

Approvals: Process Plan: SU Date: 20150828 Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D212-664-241	E								
DSI9563	B								
100	Document Control	0.00							
100	DOCUMENT CONTROL								
DC	Memo	0.00							
Doc.Control -USB or Paperwork	Photocopy bluefile and create labels as per PPP D212-664-201		CHG006						
110	Pick Kit	0.00							
110	Packaging								
Packaging	Memo	0.00							
Packaging									

MLJ 15-11-24
 DAS
 28
 3-88
 NOV 25 2015

RL 15/10/23

D212-664-201/136082

Work Order ID 136082

August 28, 2015 11:30:20 AM

136082

Page 2

Item ID: D212-664-201

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Aft Crosstube - High

Stop ***NS2***Start Date: 8/28/2015 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 9/11/2015 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	BENDING MACHINE - CROSSTUBES	0.00							
120									
CNC Bend 2	Memo	0.03							
CNC Alpha 160 Bender	***VERF SET-UP BEFORE BENDING BY: _____***								
	Bend tube as per Dwg D212-664-241 using CNC bender program 212-aft								
130	QC15- Crosstube Dimensional Check	0.00							
130									
QC	Memo	0.00							
Quality Control									

DAS

49

9-89

15/10/28

P.T.O.

Work Order ID 136082

August 28, 2015 11:30:20 AM

136082

Page 3

Item ID: D212-664-201

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Aft Crosstube - High

Stop ***NS2***

Start Date: 8/28/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 9/11/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	Crosstubes	0.00							
140									
Crosstubes									
Crosstubes	Memo	0.02							
	1-Drill pilot holes in tube as per Dwg D212-664-241 using drill Jig DT8550, DT8551, drill table DT8577 and locate tower holes #8 as per QSI0010.								
	2-Ream hole to finish size in tube as per Dwg D212-664-241 using drill Jig DT8550 & DT8551. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.								
	3-Scribe part # and batch # using vibrating stylus as per Dwg D212-664-241								
	4- ***WEAR LATEX GLOVES HANDLIND CROSSTUBE.*** Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D212-664-241								
150		0.00							
150									
HandFXtube									
Hand Finishing Crosstubes	Memo	0.00							
	IMMEDIATELY AFTER GRINDING								
	1- PRESSURE WASH X-TUBE INSIDE AND OUT								
	2- ALODINE AND ACID ETCH X-TUBE INSIDE AND OUT AS PER QSI005.								

Work Order ID 136082

August 28, 2015 11:30:20 AM

136082

Page 4

Item ID: D212-664-201

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Aft Crosstube - High

Stop ***NS2***

Start Date: 8/28/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 9/11/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160	QC7-Inspect Chemical Conversion Coat	0.00							
160									
QC	Memo	0.00				1			
Quality Control									15-11-02
170	QC5- Inspect part completeness to step on W/O	0.00							
170									
QC	Memo	0.00							
Quality Control									
180	Outsource process - NDT per QSI038 4.1	0.00							
180									
Outsource2	Memo	2.00							
Outsource process - NDT	***WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE.***								
	Liquid Penetrant Inspection as per QSI 038								
	Issue P/O: 30414								
	LPI as per ASTM 1417 Level 2								
	Attach copy of NDT results to work order								

CX NOV 12 2015 L

Work Order ID 136082***136082***

Page 5

Item ID: D212-664-201

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Aft Crosstube - High

Stop ***NS2***

Start Date: 8/28/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 9/11/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
190	Receive & Inspect for Damage & Mat'l Certs	0.00							
190	Packaging								
Packaging	Memo	0.00							
Packaging	***WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE.***								
	Ensure copy of NDT results attached to work order.								
200	QC5- Inspect part completeness to step on W/O	0.00							
200									
QC	Memo	0.00							
Quality Control	***WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE.***								
	Inspect for damage & ensure results are as per Dwg D212-664-241								

1
DAS
38
NOV 12 2015

Work Order ID 136082

August 28, 2015 11:30:20 AM

136082

Page 6

Item ID: D212-664-201

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Aft Crosstube - High

Start Date: 8/28/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 9/11/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

210

Spray Painting per QSI005 4.2
SprayPaint

0.00

210

SprayPaint

Memo

0.01

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

1-Prime inside & outside crosstube as per QSI 005 4.2

BATCH: 133084

2- ~~After painting remove masking and~~ apply matte clear coat per QSI005 4.2

BATCH: 132664

3- MASK UNDERSIDE OF CROSSTUBE AS SHONE ON DWG BEFORE PAINTING

4 -Paint Outside of Tube as per Dart QSI 005 4.2

BATCH: 133325

220

QC14- Inspect Spray Paint

0.00

220

QC

Memo

0.00

Quality Control

Then, Wrap in plastic bag to protect from scratches

DAS
38

9-89

NOV 23 2015

Work Order ID 136082

August 28, 2015 11:30:20 AM

136082

Page 7

Item ID: D212-664-201

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Aft Crosstube - High

Stop ***NS2***

Start Date: 8/28/2015 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 9/11/2015 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230	Crosstubes	0.00							DAS 41 9-89 15-11-18
230									
Crosstubes	Memo	0.01							
Crosstubes	1- Abrade mating surfaces of support and crosstube with 180 grit sandpaper, clean the area with MEK or equivalent as per dwg								
	2- Install supports with Proseal 890 per D212-664-241 and QSI 015								
	A/R Proseal 890 Batch: <u>133071</u>								
	EXP: <u>2/16</u>								
	PROSEAL CURE TIME 72 HOURS:								
	Start: <u>15-11-18</u>								
	Finish: <u>15-11-22</u>								
	3- Install clamps with rubber cushion (ENSURE CLAMPS ARE INSTALL ON TOP SIDE OF CROSSTUBE) using DT9565 as per Dwg D212-664-241.								
	Torque all clamps to 80-100 IN-LBS.								
240	QC5- Inspect part completeness to step on W/O	0.00							DAS 38 9-89 NOV 23 2015
240									
QC	Memo	0.00							
Quality Control	***RE-CHECK TORCQUE ON CLAMP AFTER PROSEAL HAS CURED FOR 72HOURS AS PER DWG.***								

Work Order ID 136082

August 28, 2015 11:30:20 AM

136082

Page 8

Item ID: D212-664-201

Accept

N900040100

Setup Start

NS1

Revision ID:

Item Name: Aft Crosstube - High

Stop

NS2

Start Date: 8/28/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 9/11/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

250

Pick Kit

0.00

250

Packaging

Memo

0.00

Packaging

1 MJS 15-11-23

260

QC4- 100% Inspect kits for completeness

0.00

260

QC

Memo

0.00

Quality Control

1X DAS 28 988 NOV 2 3 2015

270

Packaging

0.00

270

Packaging

Memo

0.00

Packaging

Identify and pack for shipping as per PPP D212-664-201
Location : FG093

FG098

1 ShmB DAS 28 988

NOV 2 5 2015

Work Order ID 136082***136082***

Page 9

Item ID: D212-664-201

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Aft Crosstube - High

Start Date: 8/28/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 9/11/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
280	QC21- Final Inspection - Work Order Release	0.00							
280									
QC	Memo	0.00							
Quality Control									

MLJ 15-11-27
MLJ 15-11-25

Picklist Print

August 28, 2015 11:30:32 AM

Page 1

Work Order ID: 136082

136082

Parent Item: D212-664-201

D212-664-201

Parent Item Name: Aft Crosstube - High

Start Date: 8/28/2015

Required Date: 9/11/2015

Start Qty: 1.00

Required Qty: 1.00

Comments:

IPP Rev:E04.02.16ReformatK/DS

IPP Rev:F 06-03-29 Remove Coments on Pick List JLM

IPP Rev:G 07-04-30 As per Rev C JLM

IPP Rev:H 08-05-22 up date Qty of rubber cushion DD verf:EC IPP REV:I

14.05.27 AS PER ECN14-570 DD VERF:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D212-664-
201TRNRevC

Manufactured No

110

Each

0.0000

1

1

D212-664-201TRNRevC

Crosstube Turning Detail

D3595-063-530

Manufactured No

230

Each

110.0000

2

2

D3595-063-530

Rubber Cushion 0.63" wide x 5.30" Long

DAS
41
9-89

15-11-18

Location

Loc Qty

Loc Code

FG

1

82656

1

LG051

109

115704

34

132515

75

D2940-1

Manufactured No

230

Each

24.0000

2

2

D2940-1

Support

**

DAS
41
9-89

15-11-18

Location

Loc Qty

Loc Code

LG052

24

128962

8

131129

10

132754

6

Picklist Print

August 28, 2015 11:30:34 AM

Page 2

Work Order ID: 136082

Parent Item: D212-664-201

Parent Item Name: Aft Crosstube - High

136082

D212-664-201

Start Date: 8/28/2015

Required Date: 9/11/2015

Start Qty: 1.00

Required Qty: 1.00

MS21920-28

Purchased

No

230

Each

132.0000

4

4

DAS

41

9-89

15-11-18

MS21920-28

Clamp

**

Location

Loc Qty

Loc Code

FG

1

105884

1

LG050

52

M130400

50

M130665

2

LG051

79

M132169

38

M132381

3

M132522

38

D3428-1

Manufactured

No

250

Each

30.0000

1

D3428-1

Placard

**

Location

Loc Qty

Loc Code

ST035

6

125453

6

ST038A

24

131158

12

133206

12

DAS
28
9-89

4
1

MCS 15-11-23

Picklist Print

August 28, 2015 11:30:34 AM

Page 3

Work Order ID: 136082

136082

Parent Item: D212-664-201

D212-664-201

Parent Item Name: Aft Crosstube - High

Start Date: 8/28/2015

Required Date: 9/11/2015

Start Qty: 1.00

Required Qty: 1.00

MS21042L6

Purchased

No

250

Each

328.0000

6

6

MS21042L6

Nut

**

MLJ 15-11-23

DAS
28
9-89

Location

Loc Qty

Loc Code

ST260a	100	
m133031	100	
ST273A	200	
m131624	200	
ST305	11	
m129909	1	
m132262	10	
t260a	17	
m131317	17	

NAS1149D0663J

Purchased

No

250

Each

1,183.000

18

18

NAS1149D0663J

Washer

**

MLJ 15-11-23

DAS
28
9-89

Location

Loc Qty

Loc Code

ST260	227	
M131618	227	
ST260a	889	
M132256	889	
ST269	67	
M126334	67	

AN6-40A

Purchased

No

250

Each

128.0000

4

4

AN6-40A

3/8-24 BOLT X 3" LONG

**

MLJ 15-11-23

DAS
28
9-89

Location

Loc Qty

Loc Code

ST286A	128	
M131618	28	
M131803	100	

August 28, 2015 11:30:34 AM

Shop Packet Print

Page 3

Picklist Print

August 28, 2015 11:30:34 AM

Page 4

Work Order ID: 136082

136082

Parent Item: D212-664-201

D212-664-201

Parent Item Name: Aft Crosstube - High

Start Date: 8/28/2015

Required Date: 9/11/2015

Start Qty: 1.00

Required Qty: 1.00

AN6-41A

Purchased

No

250

Each

77.0000

2

2

AN6-41A

Bolt

**

15-11-23

Location

Loc Qty

Loc Code

ST286A

62

M129913

2

M131957

60

ST333

15

M131618

15

DAS
28
9-89


August 28, 2015 11:30:34 AM

Shop Packet Print

Page 4

DART AEROSPACE LTD		Work Order:	136082
Description: Crosstube High Aft (205/212)		Part Number:	D212-664-201
Inspection Dwg: D212-664-241 Rev: E		Page 1 of 1	

Required Dimension	Min	Max
Height	24.17	24.43
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.70
Bending Passes	5	--
Crushing	--	7.2%

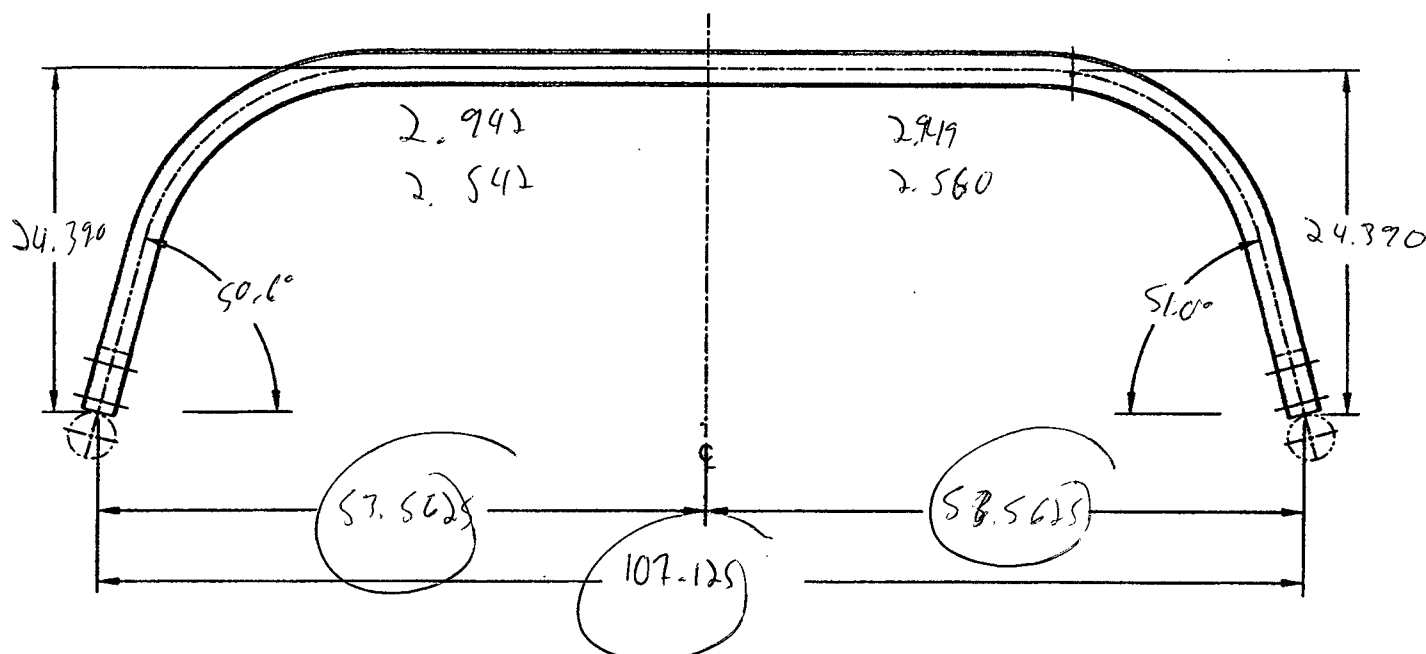

	Side A	Side B
Bending Passes	13	13
Crushing	7.2%	6.5%
Comments		

QC15 Inspection		DAS
Date		49
		15/10/25
		9-89

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	07.05.08	Dimensions updated per Dwg rev. C	KJ/JLM	
C	10.04.01	Dwg Rev updated	KJ	
D	12.04.16	Added bending, crushing dimensions	KJ	
E	14.07.08	Crushing percentage revised	KJ	

DART SERVICE INSTRUCTION

TO AMEND INSTRUCTIONS FOR CONTINUOUS AIRWORTHINESS ICA-D212-664 Rev. 6 OR LATER

REF. CANADIAN STC: SH01-9

REF. FAA STC: SR01298NY

REF. EASA STC: EASA.IM.R.S.01304

PURPOSE:

The supports on the following crosstubes are now installed using Proseal instead of Magnobond:

D212-664-101/-101B @ CHG 005

D212-664-201/-201B @ CHG 005

D412-664-105 @ CHG 002

D212-664-207/-207B @ CHG 002

D212-664-107/-107B @ CHG 002

CHANGE:

For the crosstubes listed above, section 32.4 of ICA-D212-664 is amended as follows. Use Figure 1 of this service instruction and Figures 32-2 to 32-9 of ICA-D212-664 for further reference. For crosstubes of an earlier change number, it is recommended that if the supports are removed, the supports should be reinstalled using the procedure listed below.

32.4 SUPPORT INSTALLATION

- 32.4.1 Locate the area on the crosstube for installation of support (see Figure 1 of this service instruction). For D212-664-101/-107/-201/-207 and D412-664-105 crosstubes, the outward face of the support tabs should be 14.0" (355mm) from the crosstube center for 204/205/210/412/UH-1 aircraft. For installation on 214B/B-1 aircraft, the outward face of the support tabs should be 13.75" (349mm). Ensure paint finish of crosstube is intact; touch up as required per Chapter 5 (5.3.9) of ICA-D212-664.
- 32.4.2 If present, remove any paint/primer on bottom of supports. Abrade mating surfaces of support and crosstube with 400-grit sandpaper. Saturate a clean cloth with MEK or 4105S Wash'n'Wipe Degreaser or equivalent and wipe until there is no residue.
- 32.4.3 Ensure a layer of 3M Scotch-Weld 2216 B/A Epoxy Adhesive is on the bottom of the support. If required, either apply or touch-up support to have a 0.03" to 0.05" thick layer of adhesive over the entire mating surface. Allow supports to cure for 24 hours.
- 32.4.4 Abrade mating surfaces of support (after cure) and crosstube with 180-grit sandpaper. Saturate a clean cloth with MEK or 4105S Wash'n'Wipe Degreaser or equivalent and wipe until there is no residue.
- 32.4.5 Apply a 0.04" to 0.07" thick layer of Proseal 890 Class B or AMS-S-8802 Class B sealant underneath applicable support and install support as shown in Figure 1 of this service instruction.
- 32.4.6 Install the clamps opposite to crosstube support as shown in section A-A of Figure 1. Install rubber cushions underneath each clamp around the bottom circumference of the crosstube up to the crosstube centerline. Torque clamps 80-100 in-lb (9.0-11.3 Nm). It is acceptable to use smaller or larger sized MS21920-XX clamps than those listed in ICA-D212-664, ensure that after torquing the clamps per this instruction, the nuts are in safety but not bottomed out
- 32.4.7 Prior to installing crosstube on aircraft, allow supports to cure for 72 hours and recheck torque on clamps.

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-0-01

APPROVED

BY: 
D. SHEPHERD (DE # 02)

DATE: 11.07.20

CERT. NO.: SH01-9

ISSUE NO.: 3

136082 5X 20150828

B	ADD 3M 2216 ADHESIVE TO SUPPORT	CP	11.07.15
A	NEW ISSUE	CP	11.06.14
REV.	DESCRIPTION	BY	DATE
DESIGN		DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN			
CHECKED	ASS	DRAWING NO.	REV. B
MFG. APPR.	N/A	DSI 9563	SHEET 1 OF 2
APPROVED		TITLE	SCALE
DE APPR.		SUPPORT INSTALLATION CHANGE	NTS
DATE	11.07.15	COPYRIGHT © 2011 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

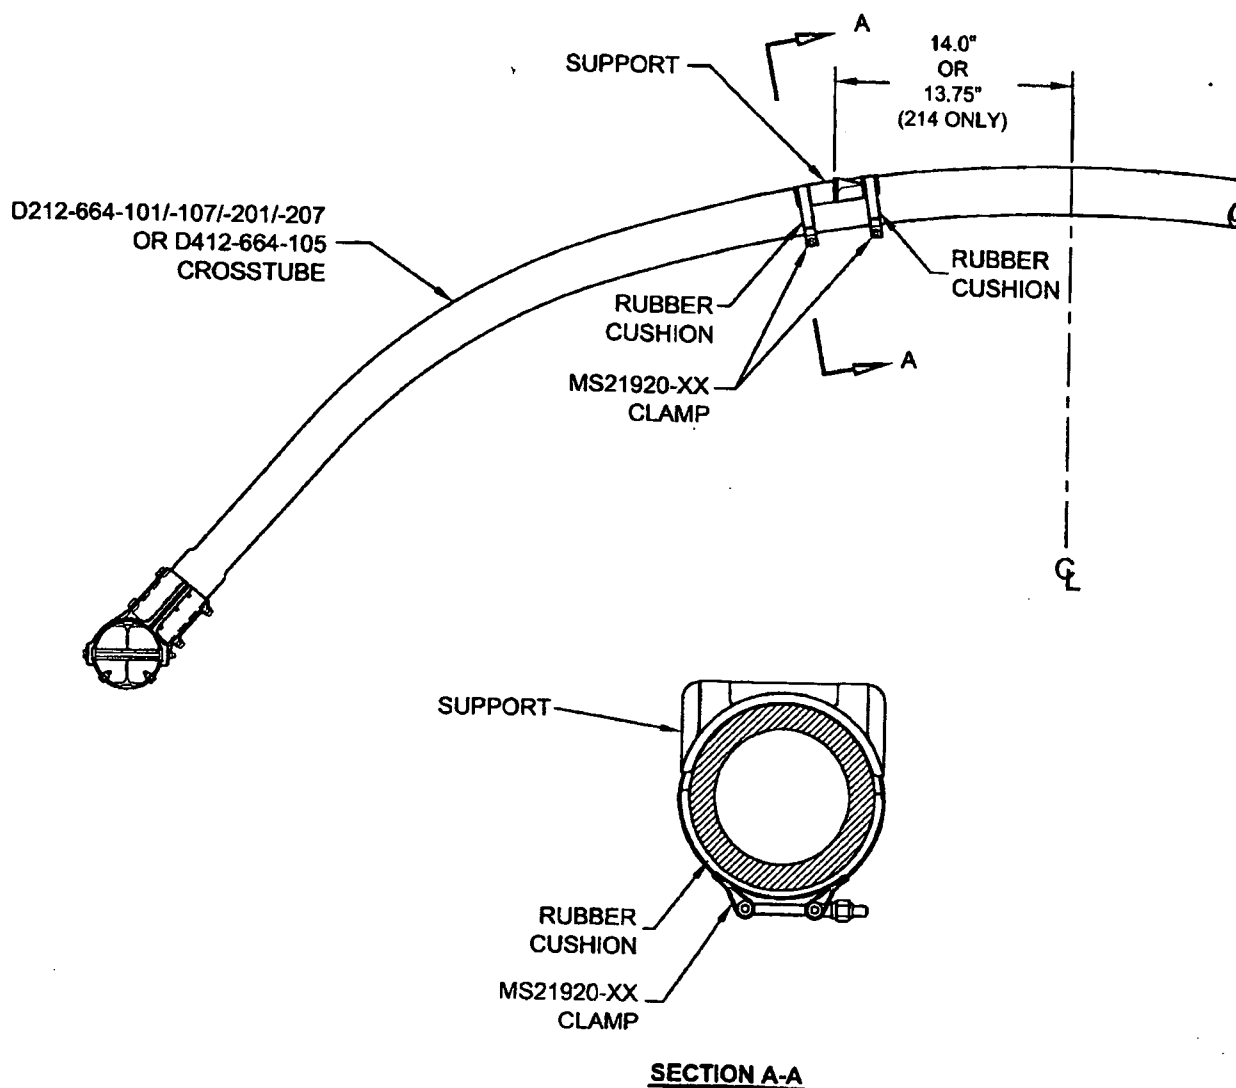


FIGURE 1: SUPPORT INSTALLATION

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: *[Signature]*
D. SHEPHERD (DE # 02)

DATE: 11.07.20
CERT. NO.: SH01-9
ISSUE NO.: 3

DESIGN	<i>qp</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	<i>qp</i>		
CHECKED	<i>ASS</i>	DRAWING NO.	REV. B
MFG. APPR.	<i>N/A</i>	DSI 9563	SHEET 2 OF 2
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	SUPPORT INSTALLATION CHANGE	NTS
DATE	11.07.15	COPYRIGHT © 2011 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

Item	Qty -241	Qty -241B	Part Number	Description
1	X		D212-664-241	CROSSTUBE ASSEMBLY (205/212 HIGH AFT)
2		X	D212-664-241B	CROSSTUBE ASSEMBLY (214 HIGH AFT)
3	1	1	D6006-129	CROSSTUBE
4	2		D2940-1	SUPPORT
5	4	4	D3595-063-530	RUBBER CUSHION
6		2	D5018-1	SUPPORT
7	4	4	MS21920-28	CLAMP (OR MS21920-30)
8	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6006-129
FINISHED LENGTH = 124.362±0.020
- FINISH: a) CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
b) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
c) MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2 / C6-3, HATCHED AREA)
d) PAINT OUTSIDE PER DART QSI 005 4.2
e) REMOVE MASKING AND APPLY MATTE CLEAR COAT
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- WEIGHT: D212-664-241/-241B = 44.2 lbs
- PART IS SYMMETRIC ABOUT CENTERLINE.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.

MACHINING

- RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.

BENDING

- BEND PROGRESSIVELY WITH A MINIMUM OF 5 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 7.2% (BASED ON O.D.) IN LOWER HALF OF R35.5 BEND AND 6% (BASED ON O.D.) ON REMAINING TUBE.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.


ASSEMBLY

- INSTALL D2940-1 / D5018-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- INSTALL MS21920-28 CLAMPS (OR -30) WITH D3595-063-530 RUBBER CUSHIONS TO SECURE THE SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE ON TOP SIDE OF CROSSTUBE.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.


RELEASED
2014-05-26

SW 136082 20150828

E	D5018-1 WAS D2940-1 (241B). PROSEAL WAS MAGNOBOND. NOTE 2: ADD INSPECTION WINDOW. NOTE 11: ALLOW 7.2% CRUSH. NOTE 15: ADD 72HR CURE AND RETORQUE FOR PROSEAL. ADD SHEET 3, CLAMPS REVERSED TO PREVENT CHAFING (ZN B7-2, B7-3). BEND HEIGHT TOL. NOW 0.25 WAS 0.13 (C1-4), INCORP DEO D-1/-2	CP	14.04.01
D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -241B (ZN D4-2, B4-2); REMOVED REF & ADD TOLERANCES (ZN D8-3 & C4-3, C6-3 & A8-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -1008 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	CP	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN	qp	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	qp		
CHECKED	DW	DRAWING NO. D212-664-241	REV. E
MFG. APPR.	SW		SHEET 1 OF 5
APPROVED	SW	TITLE CROSSTUBE ASS'Y (205/212 HI AFT)	SCALE
DE APPR.	SW		NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE SUPPLIER'S CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

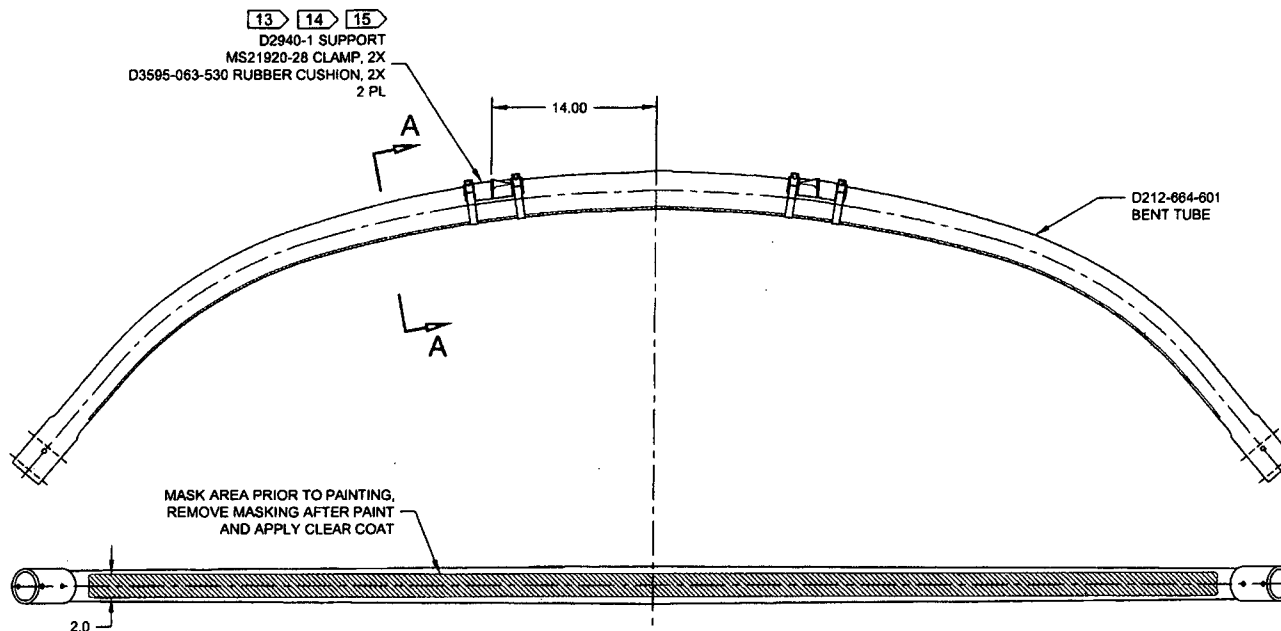


**D212-664-241
ASSEMBLY DETAIL**

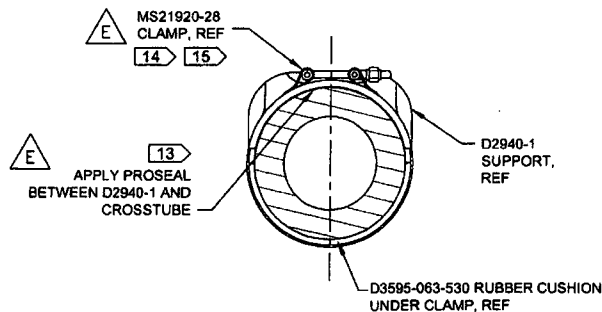

**SECTION A-A
SCALE 4X**


RELEASED
2014-05-26
MP

DESIGN	Q	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	Q		
CHECKED	SW	DRAWING NO.	REV. E
MFG. APPR.	SW	D212-664-241	SHEET 2 OF 5
APPROVED	SW	TITLE	SCALE
DE APPR.	SW	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

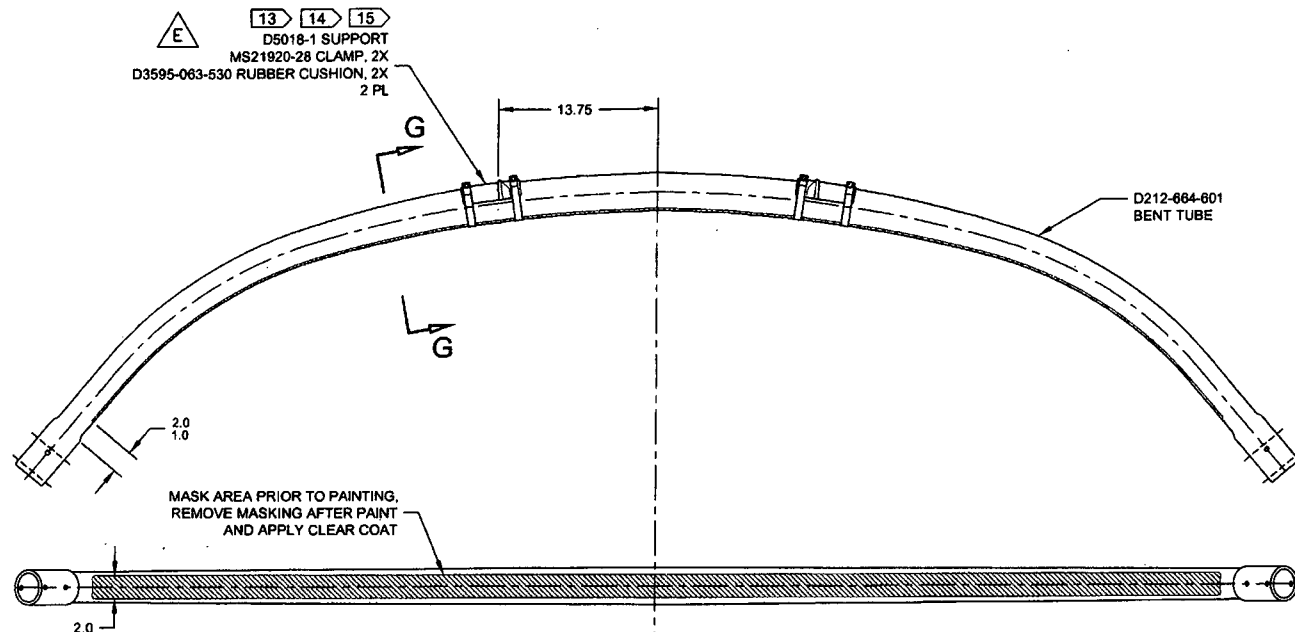


**D212-664-241B
ASSEMBLY DETAIL**

RELEASED
2014-05-26

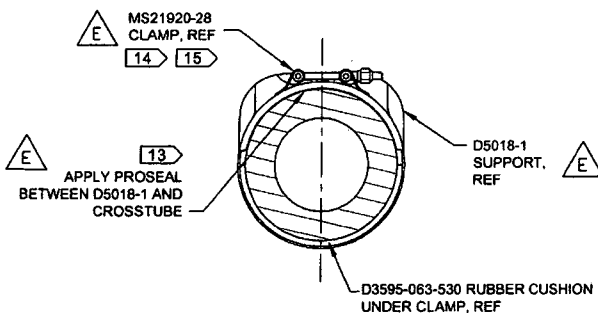


**SECTION G-G
SCALE 4X**


DESIGN	90	DART AEROSPACE LTD	
DRAWN	90	HAWKESBURY, ONTARIO, CANADA	
CHECKED	DW	DRAWING NO.	REV. E
MFG. APPR.	AP	D212-664-241	SHEET 3 OF 5
APPROVED	AP	TITLE	SCALE
DE APPR.	AP	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

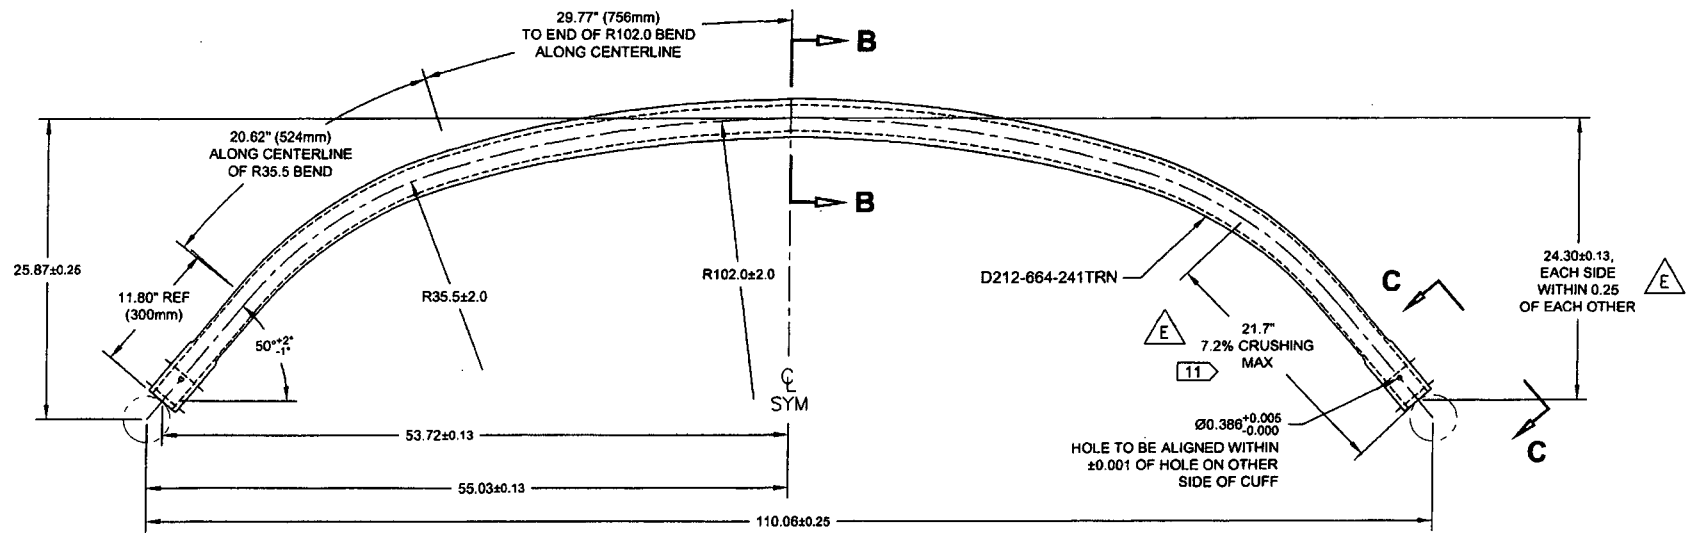

D212-664-601 11
BENDING AND DRILLING DETAIL

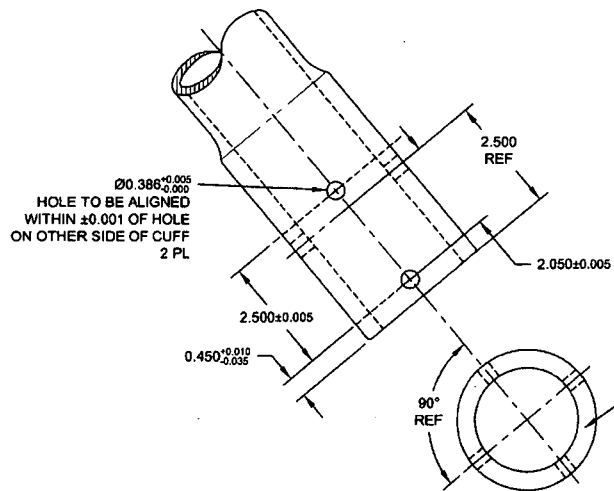

VIEW C-C: CUFF DETAIL
 SCALE 3X

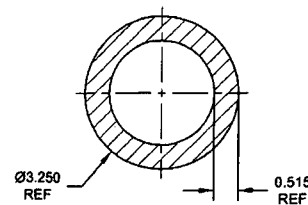

SECTION B-B
 SCALE 4X

RELEASED
 2014-05-26
WJD


DESIGN	<i>Q</i>	DART AEROSPACE LTD	
DRAWN	<i>Q</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>DL</i>	DRAWING NO.	REV. E
MFG. APPR.	<i>W</i>	D212-664-241	SHEET 4 OF 5
APPROVED	<i>W</i>	TITLE	SCALE
DE APPR.	<i>W</i>	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2009 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

R100.0 TRANSITION
BETWEEN TAPERED
SECTIONS

R100.0 TRANSITION
BETWEEN TAPERED
SECTIONS

0.515 WALL
STOCK, REF

SEE DETAIL D

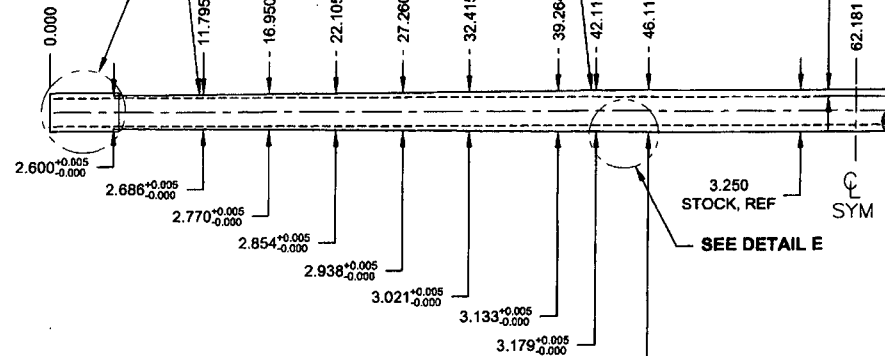

SEE DETAIL E

TAPER UNIFORMLY FROM
3.179 (+0.005/-0.000) THROUGH TO 3.276 (+0.005/-0.000)
RUNNING OFF PART


10
30° X 0.500 DEEP
CHAMFER

R0.063


SEE DETAIL F

DETAIL D:
CROSSTUBE CUFF
SCALE 5X

D212-664-241TRN
TURNING DETAIL

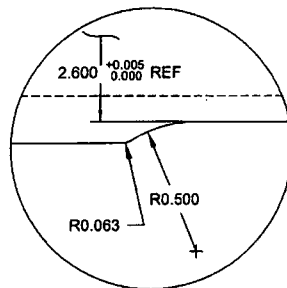

DETAIL F:
CUFF TRANSITION
SCALE 10X

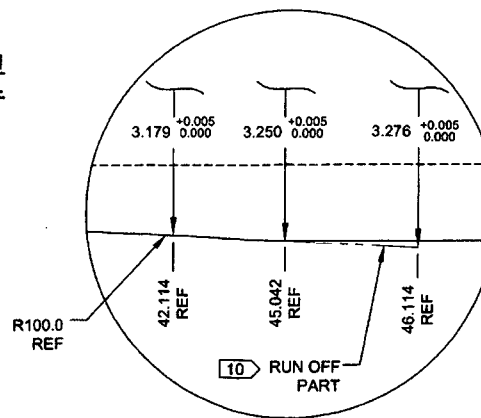

DETAIL E:
TAPER RUN-OFF
NOT TO SCALE

RELEASED
2014-05-26

DESIGN	DP	DART AEROSPACE LTD	
DRAWN	DP	HAWKESBURY, ONTARIO, CANADA	
CHECKED	DW	DRAWING NO.	REV. E
MFG. APPR.	[Signature]	D212-664-241	SHEET 5 OF 5
APPROVED	[Signature]	TITLE	SCALE
DE APPR.	[Signature]	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

212-664-201 "Folio"

Batch#:

Setup

Rollers 3.25 x 3 ****without spacers***

Large Table, Shims 1.85" for SA bend, shims 1.7" for SB bend (new buggy)/adjust supporting rollers as required.

From cuffs, mark tube @ 32.1875 & **35.1875 RED** and center line

Middle Bend

Start bending on 32.1875 line w/tube on LARGE TABLE. Approach from this line is **2775 on both Y&W**. Use programs middleauto2.

SEE NOTES (14/04/09) FOR INSTRUCTIONS ON BENDING MIDDLES

Side bends

Start bending on **35.1875** line with long part of tube on LARGE TABLE. approach of **Y 1900 W 3735**

Run programs s01-s05 without stopping, CHECK, then s06 to 16 to finish. CHECK between each program..

Approach for Prog s06 to s16 is Y 2190 and W 3735

CHANGED 35.187 LINE TO 34.9, did not work! DP 11-8-11

11/11/02 tried new tangent line today. tube was far too high. nearly scrapped. 24.75 on one side, 24.5625 on the other. max tolerance is 24.43. jw

12/05/29 NOW USING ORIGINAL TANGENT LINES AGAIN

14-03-10 bent 4 tubes, all were on reference lin for middle bend. all tubes turned out too high, next time, try underbending muddles by approx 1/16" to try to achieve nominal measurement on height and span. tubes were finishing at program 8 - JW

14-04-09 removed points and re-adjusted "x" movement on program middleauto. RENAMED middleauto2. this underbent middles by aprox 0.0625"-0.125" then ran 1-5 CHECK, 5c, 6,7,8 checking between each. this has fixed height and tubes were finishing closer to nominal measurements. program "middleauto" is still in system as a failsafe.

Passes:

Handwritten notes and diagrams illustrating the bending process and passes.

Left side (SA bend):

- Passes 1, 2, 3, 4, 5 (crossed out)
- Passes 6, 7, 8 (crossed out)
- Passes 10, 11, 12, 14, 16, 17 (crossed out)

Right side (SB bend):

- Passes 1, 2, 3, 4, 5 (crossed out)
- Passes 6, 7, 8 (crossed out)
- Passes 10, 11, 12, 14, 16, 17 (crossed out)

Center notes:

- MA2
- (5)
- (13)
- (13)

DQA: AA Date: 15/12/09

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: KPMDate: 15/12/01Work Order update only ☐

Work Order: <u>136082</u> Part No. <u>D212-664-201</u> NCR No. <u>15-5471</u>	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☒ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Cross tube ☒</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>			Skid-tube ☐	Cross tube ☒	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																																																																																	
Skid-tube ☐	Cross tube ☒	Water Jet ☐	Engineering ☐																																																																																																																																	
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																																																																																	
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																																																																																	
Large Fab ☐	Composite ☐	Supplier ☐																																																																																																																																		
Date: <u>15/10/28</u>	Step #: <u>120</u>	QTY Effective: <u>1</u>	MRB (QSI042) Approval DAS 12 9-89 <u>15/10/28</u>																																																																																																																																	
Description Work Order Deviation		Disposition		Completed By																																																																																																																																
Width is under tolerance. P.C. operator ran one one program too much		Acceptable. Width is within what has been accepted in the past with no reported fit issues.		DAS 12 9-89 <u>15/10/28</u>																																																																																																																																
				Lead hand / Supervisor Approval Verification																																																																																																																																
				<u>[Signature]</u> 15-10-28																																																																																																																																
				QC / QA Coordinator Approval DAS 9 9-89 <u>15-10-28</u>																																																																																																																																
Root Cause <table style="width:100%;"> <tr><td>Environment</td><td>☐</td><td>No Re-verification</td><td>☐</td></tr> <tr><td>Design</td><td>☒</td><td>Operator</td><td>☒</td></tr> <tr><td>Doc/Data</td><td>☐</td><td>Offset/Setup</td><td>☐</td></tr> <tr><td>Equip/Tooling</td><td>☐</td><td>Supplier</td><td>☐</td></tr> <tr><td>Handling/Pre</td><td>☐</td><td>Training</td><td>☐</td></tr> <tr><td>Material</td><td>☐</td><td>Use for Testing</td><td>☐</td></tr> <tr><td>Internal Transport</td><td>☐</td><td>Poor Information</td><td>☐</td></tr> <tr><td>Tribal Knowledge</td><td>☐</td><td>Rushing</td><td>☐</td></tr> <tr><td>LOA</td><td>☐</td><td>Product Improvement</td><td>☐</td></tr> <tr><td>Substation</td><td>☐</td><td>Process Improvement</td><td>☐</td></tr> <tr><td>Past Expiry Date</td><td>☐</td><td>Manufacturing Process</td><td>☐</td></tr> <tr><td>Misidentified</td><td>☐</td><td>Past Due</td><td>☐</td></tr> </table>		Environment	☐	No Re-verification	☐	Design	☒	Operator	☒	Doc/Data	☐	Offset/Setup	☐	Equip/Tooling	☐	Supplier	☐	Handling/Pre	☐	Training	☐	Material	☐	Use for Testing	☐	Internal Transport	☐	Poor Information	☐	Tribal Knowledge	☐	Rushing	☐	LOA	☐	Product Improvement	☐	Substation	☐	Process Improvement	☐	Past Expiry Date	☐	Manufacturing Process	☐	Misidentified	☐	Past Due	☐	FAULT CATEGORY <table style="width:100%;"> <tr><td>Pressure/Forced</td><td>☐</td><td>Temperature/Cure</td><td>☐</td><td>Power Loss/Surge</td><td>☐</td><td>Positioned Wrong</td><td>☐</td></tr> <tr><td>Bending</td><td>☒</td><td>Set-up</td><td>☐</td><td>Folio/Program</td><td>☐</td><td>Outside Dimensions</td><td>☐</td></tr> <tr><td>Centre Not Concentric</td><td>☐</td><td>BOM/Route</td><td>☐</td><td>Grain</td><td>☐</td><td>Over/Under tolerance</td><td>☐</td></tr> <tr><td>Cracks</td><td>☐</td><td>Broken/Damage/Defect</td><td>☐</td><td>Weld</td><td>☐</td><td>Part Incorrect</td><td>☐</td></tr> <tr><td>Crimp/Kink/Ripple/Wave</td><td>☐</td><td>Inspection Incomplete/Unqualified</td><td>☐</td><td>Wrong Stock Pulled</td><td>☐</td><td>Part Lost/Missing</td><td>☐</td></tr> <tr><td>Cuffs</td><td>☐</td><td>Contamination</td><td>☐</td><td>Out of Sequence</td><td>☐</td><td>Part Moved</td><td>☐</td></tr> <tr><td>Crushing</td><td>☐</td><td>Countersink</td><td>☐</td><td>Off-set</td><td>☐</td><td>Drawing</td><td>☐</td></tr> <tr><td>Heat Treat</td><td>☐</td><td>Cut Too Short</td><td>☐</td><td>Mislabeled</td><td>☐</td><td>Finish</td><td>☐</td></tr> <tr><td>Wave/Twist in Tube</td><td>☐</td><td>Instructions Incomplete/Unclear</td><td>☐</td><td>Fit/Function</td><td>☐</td><td>Misread</td><td>☐</td></tr> <tr><td>Marks/Chatter</td><td>☐</td><td>Drill Holes</td><td>☐</td><td>Misaligned/off center</td><td>☐</td><td>Turning Sequence</td><td>☐</td></tr> </table>			Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐	Bending	☒	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Environment	☐	No Re-verification	☐																																																																																																																																	
Design	☒	Operator	☒																																																																																																																																	
Doc/Data	☐	Offset/Setup	☐																																																																																																																																	
Equip/Tooling	☐	Supplier	☐																																																																																																																																	
Handling/Pre	☐	Training	☐																																																																																																																																	
Material	☐	Use for Testing	☐																																																																																																																																	
Internal Transport	☐	Poor Information	☐																																																																																																																																	
Tribal Knowledge	☐	Rushing	☐																																																																																																																																	
LOA	☐	Product Improvement	☐																																																																																																																																	
Substation	☐	Process Improvement	☐																																																																																																																																	
Past Expiry Date	☐	Manufacturing Process	☐																																																																																																																																	
Misidentified	☐	Past Due	☐																																																																																																																																	
Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐																																																																																																																													
Bending	☒	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐																																																																																																																													
Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐																																																																																																																													
Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐																																																																																																																													
Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐																																																																																																																													
Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐																																																																																																																													
Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐																																																																																																																													
Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐																																																																																																																													
Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐																																																																																																																													
Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐																																																																																																																													
OTHER :																																																																																																																																				



Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
Tel: 613 632 9577
Fax: 613 632 1053

PURCHASE ORDER

Purchase Order ID **PO30414**

Purchase Order Date 11/11/2015

PO Print Date 11/12/2015

Page Number 5 of 8

Order From :

VC-SKY001

Ship To : DART AEROSPACE LTD

SKYSERVICE
6120 MIDFIELD ROAD
MISSISSAUGA, ONTARIO L5P 1B1
CANADA

1270 ABERDEEN
HAWKESBURY, ON K6A 1K7
CANADA

Contact Name

Vendor Phone

905-678-5636

Ship To Contact

Ship To Phone

Ship Via:

Delivered

Ship Acct:

Buyer

Chantal Lavoie

Customer POID

Customer Tax #

10127-2607

Terms

Net 30

Currency

CAD

FOB

FCA - (Free Carrier)

Line Total: \$96.50

12 138551

D212-664-101
CROSSTUBE

11/12/2015

1.00

\$96.50

\$96.50

Yes

11/12/2015

SAME AS ABOVE

Line Total: \$96.50

13 136081

D212-664-201
CROSSTUBE

11/12/2015

1.00

\$96.50

\$96.50

Yes

11/12/2015

SAME AS ABOVE

Line Total: \$96.50

14 136082

D212-664-201
CROSSTUBE

11/12/2015

1.00

\$96.50

\$96.50

Yes

11/12/2015

SAME AS ABOVE

Note:

11/12/2015

8015-11-12



skyservice Work Order Traveler

Sky Service F.B.O. Inc.

DOT APP 53-89 / EASA 145.7142 / BDA AMO 385

WO #: MWO26386	Customer: Dart Aerospace Ltd.	Dept: NDT YUL	Reference: 30414
Descr:	PN:	S/N:	Qty: 1
Make:	Model:	Reg:	A/C S/N:
TSN:	CSN:	TSO:	
Task: UNSCHEDULED			Sequence: 1

Work Required:

CARRY OUT NDT ON 18 CROSSTUBES AND 4 RAPPEL SLIDE BARS AS PER PO30414

4 RAPPEL SLIDE BARS, ITEM ID# D3011-1, WORK ORDER ID# 136063


8 FWD CROSSTUBES, ITEM ID# D212-664-101, WORK ORDER ID# 138548, 136075, 138547, 138549, 138551, 138614, 138550, 138615

7 AFT CROSSTUBES, ITEM ID# D212-664-201, WORK ORDER ID# 136085, 136081, 136083, 130376, 136082, 136084, 130375

3 FWD CROSSTUBES, ITEM ID# D206-667-101, WORK ORDER ID# 135128, 135129, 135130

Action Taken:						Date:	Initial/Stamp:
LPI C/O IAW ASTM E-1417M13 NO CRACK FOUND PEN. ZL-56, MPO13600, UV M-20141, CLEANER SKC-S MPO13923 , DEV. MPO11715						NOV 11 2015	
Description	Location	P/N	Qty	Batch	S/N Off	S/N On	
		DAS					
		38					
		9-89					
		NOV 17 2015					

I certified that the maintenance described above has been performed in accordance with the applicable standard of airworthiness.

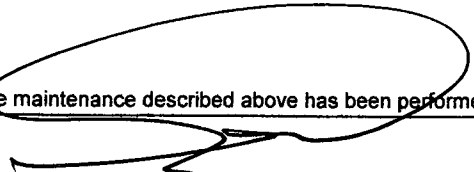Signature: 	ACA/SCA Stamp 	Date: NOV 11 2015
Name: BAFIR DEKIRIAN		